

# T ECHNICAL INFORMATION




87942

November 2010

- Subject** ▶ Addition of Front Spacer,  
Change of Under Driver Guide, M5x35 Hex Socket Head Bolt, Flat Washer 5, Hex. Wrench 4
- For Models** ▶ GN900
- Country** ▶ All countries
- Description** ▶ For further improvement in durability of Cylinder head;
  - 1) Front spacer has been added.
  - 2) Under driver guide, M5x35 Hex socket head bolt, Flat washer 5 and Hex. wrench 4 have been changed.

**Note:** In case of Cylinder head failure, all the following parts have to be replaced.

In case of Under driver guide failure, Under driver guide and two M5x35 Hex socket head bolts have to be replaced.

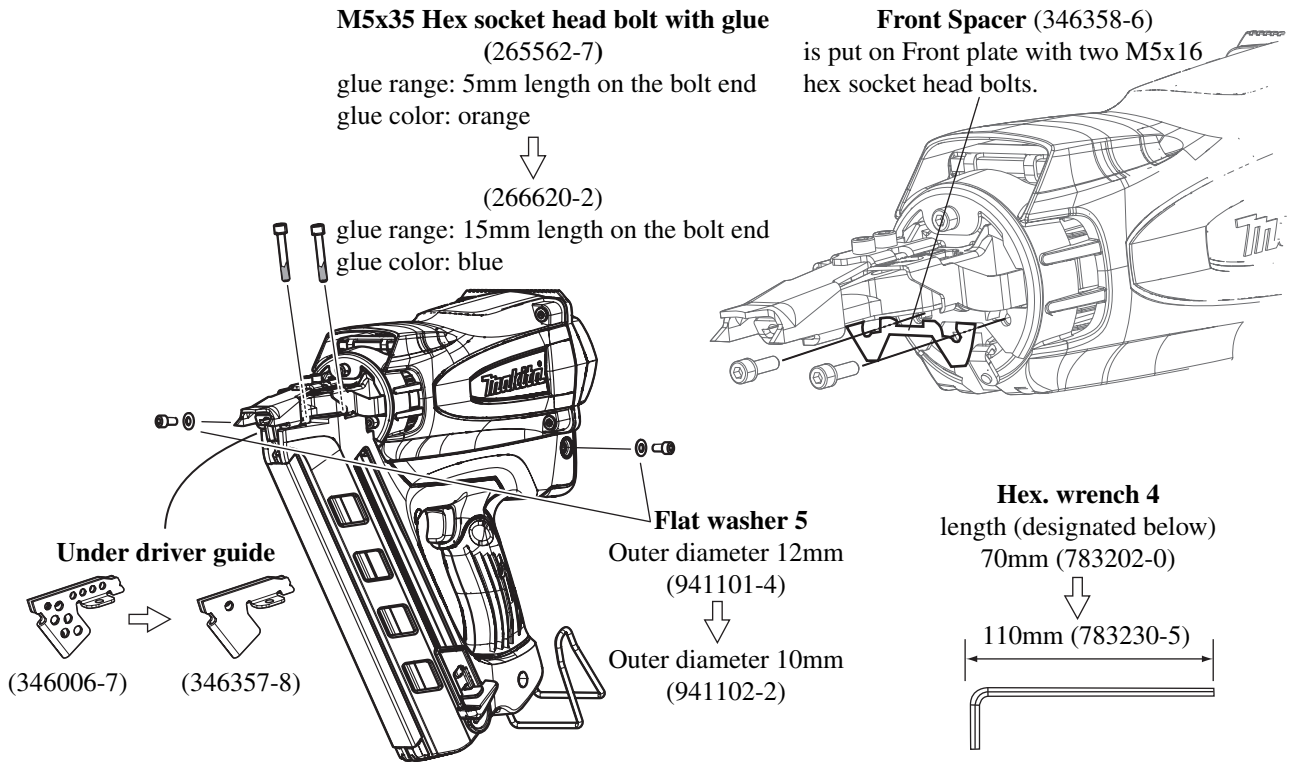

## Interchangeability(I/C)

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
100				Front Spacer 346358-6	1	
020	Under Driver Guide 346006-7	1	←	Under Driver Guide 346357-8	1	
009	Hex Socket Head Bolt M5x35 265562-7	2	←	Hex Socket Head Bolt M5x35 266620-2	2	
068, 096	Flat Washer 5 941101-4	2	←	Flat Washer 5 941102-2	2	The current remains available.
A02	Hex. Wrench 4 783202-0	1	←	Hex. Wrench 4 783230-5	1	

### Interchangeability mark;

The arrow ← means that the new part can be substituted for the current.

## Implementation

From serial No. 15772